




Reflash Full Size LYNK Telemeter

Items needed to perform reflash

- Two USB dongles included with welcome kit (Male USB-A to Female USB-B extension cables, available at Amazon)
- USB Flash drive with the most recently released version of the LYNK Software (contact LYNK Support for assistance with this if needed)
- USB Keyboard that has an ESC key, Up/Down arrows, and Number Keys.
- Scan the QR code below to order a LYNK Reflash Kit that includes the necessary cords and a USB drive (Marketplace account required)

1. Power off the LYNK device by removing the MDB cable.
2. Insert the Orange tipped USB Type A cable into the Top Right USB port on the LYNK.
3. Insert the Black tipped USB A Port into the Top Center USB port on the LYNK.
4. Connect the USB Flash Drive to the other end of the Orange tipped cable, and the USB keyboard into the Black USB dongle.
5. Plug back in the MDB to power on the LYNK device and monitor the System Initializing progress bar until it reaches 100%. Once it reaches 100%, repeatedly hit the ESC key to access the Program Manager.
6. On the program manager, use the Up and Down keys to highlight the "GC_Bootloader" app

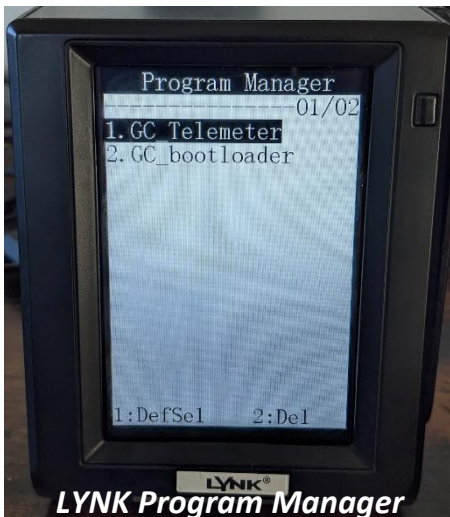

7. Hit 2 on the keyboard. "OK To Delete?" will be displayed on the screen. Hit Enter to delete the bootloader app
8. Hit 2 again with "GC_Telemeter" selected, then hit Enter to confirm the delete. The Program Manager screen should now be blank.
9. On the keyboard, hit keys 0, then 1(download AP), then 2(USB DISK). This sequence of keys will prompt the Telemeter to start updating the device based on the contents of the flash drive that is connected to the orange USB dongle.
10. Once complete, the device will reboot. Note that this can take as long as 30 minutes to complete.
11. Once the device is back on the red USConnect screen, you can unplug the USB dongles from the back. The reflash is complete.



LYNK Support

O: 336-663-8343 x 206

E: LYNKSupport@globalconnect.biz

